

## European Office

Taylor House • 34 Sherwood Road • Bromsgrove Worcestershire • B60 3DR • England


Tel: 44 (0) 1527 520 999 Fax: 44 (0) 1527 501 999 E-mail: info@sti-emea.com • Web: www.sti-emea.com

USA - Headquarters

2306 Airport Road • Waterford, Michigan 48327-1209 Phone: 248-673-9898 • Fax: 248-673-1246

Toll Free: 800-888-4784 • E-mail: info@sti-usa.com

Web: www.sti-usa.com

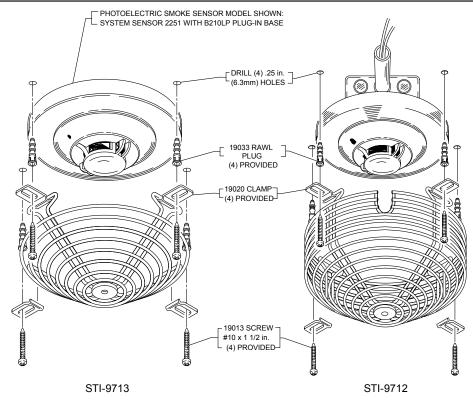




Do not attempt to install the guard until the smoke sensor has been tested and in proper working order according to the manufacturer's installation directions furnished with the sensor unit.

## **OPTIONAL FASTENERS**


- 1. KIT-82 #8 x 1 1/2" tamper resistant stainless steel screws
- 2. 19038 tamper resistant bit with 5/16" hex drive

## **SERVICE**

- Periodic cleaning of the smoke detector is required so dust and other matter does not accumulate.
- To service the smoke sensor unit, loosen but do not remove the (4) screws, rotate clamps and DRILL (4) .25 in. carefully remove the wire guard.



STI-9713

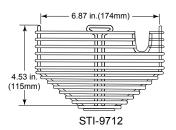

## **APPROVALS**

DSTI-9713 is UL Listed No. S3504 for use with the following smoke detectors: System Sensor Models 2251, 2251T, 2251B, 2251TB, 2251TM, 2251TMB, 2251BR, 2551, 2551T, FTX-P1, FCI Models ASD-PL, ASD-P, ASD-PH, ASD-PTL, ASD-FILTEREX, ASD-FILTREXF, MCS-ACCLIMATE, ASD-PL2, ASD-PL2F, ASD-PL2F, ASD-PL2F, MCD-ACCLIMATE2, MCS-ACCLIMATE2F, ASD-PL2FR, Secutron Models MR1-2251, MR1-2251B, EST Models 2251F, 2251FB, Mircom Models MIX-2251, MIX-2251B, Intelligent Systems Model ISL 2251, JCI Model 2951J, ADT Model 2951ADT, Fire-Lite Model SD355, Gamewell Model SS-P, Honeywell Models TC806B1076, TC806B1001 under 300 Fpm, Notifier Model FSP-751.

Three year warranty or a one year limited warranty (from date of purchase) on most products. See website for details. Electronic warranty form at www.sti-usa.com/wc14.



All specifications and information shown were current as of publication and are subject to change without notice.

